



Your Local Service Center

Modern Auto & Tire

271 Middlesex Road
Tyngsborough, MA 01879
(978) 649-9111
billing@modernautosales.com
<https://www.modernautosales.com/auto-and-tire-service-in-tyngsboro.htm>

RO #107669

Service Advisor: Kevin Viera

Date Created: 01/28/26 at 03:51 PM

EST

Client: Modern Auto Sales

Vehicle: 2021 Kia Forte GT

2021 Kia Forte GT 1.6L 4Cyl GAS Turbocharged
VIN: 3KPF4AC1ME281866
License: 281866
Unit #: 142-26-033T | Color: White
Odometer In: 77575 / Out: N/A

RO # 107669
PO # -
Save Parts: No

Client concerns:

- Safety Check
- Needs wipers
- Has front and rear pulse

Inspection Rating Key:

Checked & Okay Requires Attention Soon Requires Immediate Attention — Not Applicable

Safety Check

TECH: Trevor Frey

— Technician Concerns

Tech Findings

Finding:

— Test Drive

4X4 Operation

Finding:

A/C

Finding:

Heat

Finding:

Wipers

Finding: Needs Wiper Blades - During todays visit we noticed your wiper blades need to be replaced

Power Windows

Finding:

Power Locks

Finding:

Radio

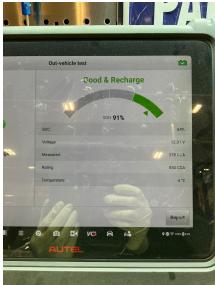
Finding:

Horn

Finding:

Check Engine Light

Finding:

<input checked="" type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Air Bag Light	Finding:
<input type="checkbox"/> <input type="checkbox"/> <input checked="" type="checkbox"/> <input type="checkbox"/> Noise While Driving	Finding: Brake noise
<input type="checkbox"/> <input type="checkbox"/> <input checked="" type="checkbox"/> <input type="checkbox"/> Brake Pulse	Finding: Front and rear
<input checked="" type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> OBD-II readiness monitors - ready?	Finding:
	
 While on the Ground	
<input checked="" type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> All Lights	Finding:
<input checked="" type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Parking Brake	Finding:
 Under The Hood	
<input type="checkbox"/> <input type="checkbox"/> <input checked="" type="checkbox"/> <input type="checkbox"/> Oil Change	Finding: Engine oil low, bottom of dipstick, very dark and smells burnt. Recommend oil change and EPR service to reduce oil consumption to prevent possible future engine issues.
<input checked="" type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Belts	Finding:
<input checked="" type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Battery Check	Finding:
	
<input type="checkbox"/> <input type="checkbox"/> <input checked="" type="checkbox"/> <input type="checkbox"/> Engine Air Filter	Finding: Engine and cabin air filters filthy. Recommend replace engine and cabin air filters.
	
<input checked="" type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Hoses	Finding:

Front Tires



Finding: Green - 10/32 - The Front tires are good - Measured at 10/32 or better

Rear Tires



Finding: Green - 10/32 - The Rear tires are good - Measured at 10/32 or better

Front Brakes



Finding: Pads at 0mm. Front brakes pulsing, pads heavily worn and rotors rotting. Calipers and slide pins OK at this time. Recommend replace front brake pads and rotors.

Rear Disc Brakes



Finding: Pads measure 4mm. Rear brakes pulsing, rotors rotted and pads sticking in brackets. Calipers and slide pins move OK at this time. Recommend replace rear brake pads and rotors.

Rear Drum Brakes

Finding:

Oil Leaks

Finding:

Coolant Leak

Finding:

<input checked="" type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Diff Leaks	Finding:
<input checked="" type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Transmission Leak	Finding:
<input checked="" type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Exhaust Leak	Finding:
<input checked="" type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Inspect Front Suspension	Finding:
<input checked="" type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> Inspect Rear Suspension	Finding:
    Other Findings	
<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> 1 - Other Findings	Finding:
<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> 2 - Other Findings	Finding: